

15 August 2006

Rich Wall shift instructions

RW frontend electronics reload

In the case of:

- Some holes in the RW hit profiles (booky)
- MurtpyTV errors (RW detector, SrcID = 432 stays RED or ORANGE in MTV diagnostic window)

ACTION: The whole chain of the RICH WALL detector (Frontend - Multiplexer - Catch) must be reloaded (reinizialized) in the way as it shown below:

step 1.: Catch loading:

```
LOAD -A 432
```

step 2.: MULTIPLEXERs loading:

- 1) ssh pccofe26
- 2) cd /online/detector/richwall/HotGesica
- 3) *./load_all.sh*
- 4) exit

step 3.: Frontends loading:

- 1) ssh pccofe19
- 2) cd /online/detector/richwall/config
- 3) *./rw_init . -r*

- 4) `./rw_init . -i`
- 5) exit

IF DOES NOT HELP - call expert: 164874

RW HV settings

In the case of HV trips, please, before put HV on be sure that beam conditions are nominal and both COMPASS spectrometer magnets are ON (apart of special alignment runs with low intensity beam).

In the case of HV setting loses, please, make an export of this settings from the most fresh RW DCS settings file.

MWPC slow control account:

Username: Rwall

Password: RW

RW gas system

In the case of any problems which coasured the persantege of CO2 changes in the gas mixture - contact the person ONCALL:

RW ONCALL: 16 4874